

Car Stereo Service Bulletin

CSA-14

Sony Service Company - Technical Services
A Division of Sony Electronics Inc.
Sony Drive, Park Ridge, New Jersey 07656

Model: XES-C1

No. 374

Subject: Compatibility Information: IC104/IC501

Date: August 22, 1995

Symptom:

(**)

The original signal processor IC104 (CXD2500Q) is no longer available, and is being replaced by type CXD2500BQ. This new type signal processor IC is not compatible with the original system control IC501 (uPD75116GF-E25-3BE).

Solution:

When replacing the original signal processor IC104 with the new type (CXD2500BQ) you must also replace the system control IC501 with type uPD75P116GF-3B3.

REF	FORMER		NEW	
	DESCRIPTION	PART NUMBER	DESCRIPTION	PART NUMBER
IC104	IC, CXD2500Q	8-752-335-15	IC, CXD2500BQ	8-752-352-93
IC501	IC, UPD75116GF- E25-3B3	8-759-154-97	IC, UPD75P116GF- 3BE	8-759-149-44



