

Car Stereo Service Bulletin

CSA-14

Sony Service Company - Technical Services
A Division of Sony Electronics Inc.
Sony Drive, Park Ridge, New Jersey 07656

Model: MDX-C150

No. 375

Subject: Improving Display Readability.

Date: August 22, 1995

Symptom:

(13) The customer may complain that the display is difficult to read.

Solution:

If the customer complains of this problem, change the value of R966 on the KEY board as shown below.

REF	FORMER		NEW	
	DESCRIPTION	PART NUMBER	DESCRIPTION	PART NUMBER
R966	RESISTOR, METAL CHIP, 6.8K, 1/16 W	1-216-831-11	RESISTOR, METAL CHIP, 4.7K, 1/10 W	1-216-065-00

