

Car Stereo Service Bulletin

CSA-14

Sony Service Company - Technical Services
A Division of Sony Electronics Inc.
Sony Drive, Park Ridge, New Jersey 07656

Model: MDX-40/400

No. **376**

Subject: Skipping.

Date: September 13, 1995

Symptom:

(57)

The unit skips while playing recordable or pre-recorded discs

Solution:

If the customer complains of these symptoms, implement the changes shown below.

REF	DESCRIPTION	PART NUMBER
-	RETAINER	3-916-086-01


Applicable Serial Numbers: MDX-40 11669 - 17050
 MDX-400 15187 - 20882

Procedure

- 1- Remove and discard the retainer which secures the flex cable to the optical pickup block.
- 2- Clean the area from which the retainer was removed with alcohol.
- 3- Install the new retainer which includes a lead wire.
- 4- Secure the lead wire with a small amount of glue as shown. **Be sure to keep the height of the glue droplet to 1 mm or less.**
- 5- Dress the lead wire snugly along the top of the optical pickup block and down the side as shown.
- 6- Solder the lead wire to the laser ground trace on the flex cable as shown.

(Continued)



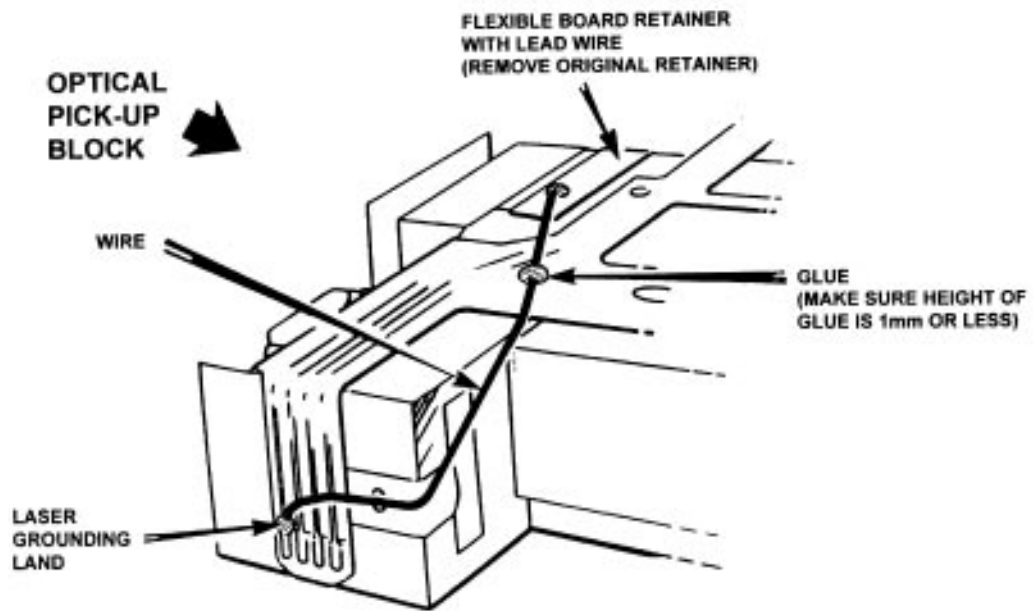

Filename: CAR0376.SB
Directory: J:\SBDOC\SEP95
Template: C:\WINWORD\S_BULL.DOT
Title:
Subject:
Author: Hoyt Wing Lee
Keywords:
Comments:
Creation Date: 09/13/95 11:19 AM
Revision Number: 2
Last Saved On: 09/13/95 11:19 AM
Last Saved By: Hoyt Wing Lee
Total Editing Time: 0 Minutes
Last Printed On: 04/01/96 11:04 AM
As of Last Complete Printing
Number of Pages: 2
Number of Words: 195 (approx.)
Number of Characters: 1,113 (approx.)