

Car Stereo Service Bulletin

CSA-14

Sony Service Company - Technical Services
A Division of Sony Electronics Inc.
Sony Drive, Park Ridge, New Jersey 07656

Model: XDP-U50D

No. 377

Subject: No Audio Or Distorted Audio When Connected To CDX-91 or MDX-40.

Date: September 13, 1995

Symptom:


(51)

When the CDX-91 or MDX-40 is connected to the XDP-U50D "ANALOG IN 2" the audio might not be heard, or might sound distorted.

Solution:

If the customer complains of this problem, replace R213 on the XDP-U50D Main board with a jumper wire as shown below.

REF	FORMER		NEW	
	DESCRIPTION	PART NUMBER	DESCRIPTION	PART NUMBER
R213	RESISTOR, MTL GLAZE, 470 OHM	1-202-999-11	JUMPER WIRE	-

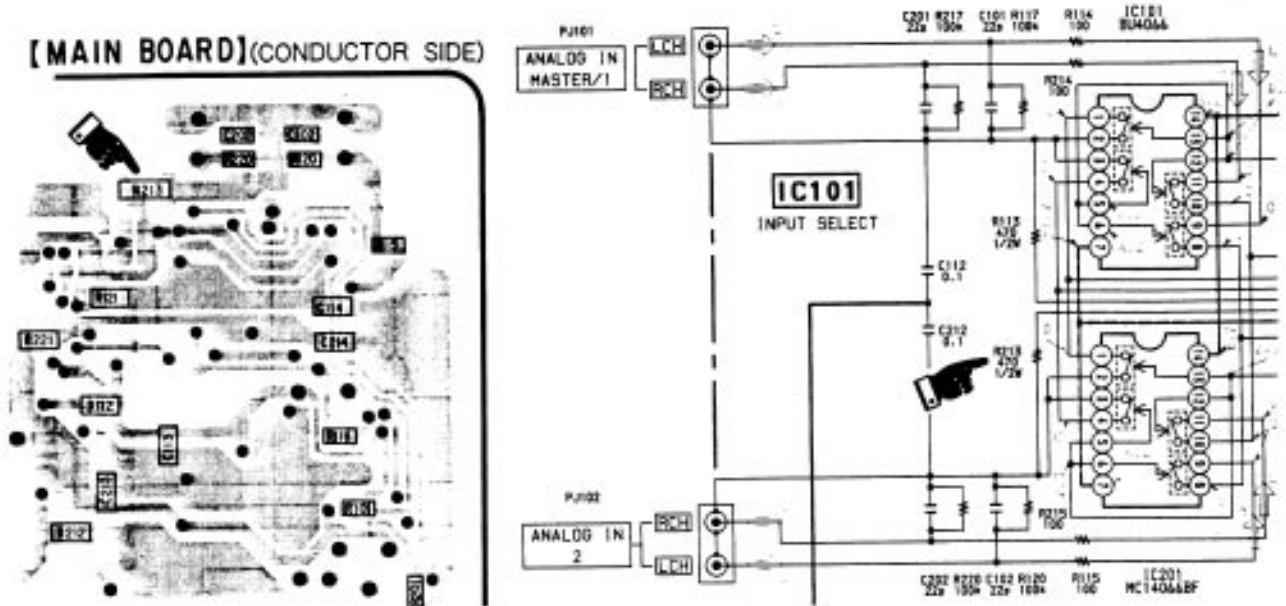

Applicable Serial Numbers: up to 40,510



Filename: CAR0377.SB
Directory: J:\SBDOC\SEP95
Template: C:\WINWORD\TEMPLATE\S_BULL.DOT
Title:
Subject:
Author: Hoyt Wing Lee
Keywords:
Comments:
Creation Date: 09/13/95 11:21 AM
Revision Number: 2
Last Saved On: 09/13/95 11:21 AM
Last Saved By: Hoyt Wing Lee
Total Editing Time: 0 Minutes
Last Printed On: 04/01/96 11:04 AM
As of Last Complete Printing
Number of Pages: 1
Number of Words: 144 (approx.)
Number of Characters: 823 (approx.)