

Car Stereo Service Bulletin

CSA-14

Sony Service Company - Technical Services
A Division of Sony Electronics Inc.
Sony Drive, Park Ridge, New Jersey 07656

Model: XM-4525

No. 378

Subject: Power Supply Noise Heard Through Speakers.

Date: September 13, 1995

Symptom:

(54)


Noise generated by the power supply may be heard through the speakers. This problem may be caused by C904 being defective.

Solution:

If the customer complains of this problem check C904 on the Main board and replace it if it is found to be defective. **Note that the polarity indicator silkscreened on the board is incorrect. The capacitor must be installed with polarity opposite that which is silkscreened on the board.**

| REF | DESCRIPTION | PART NUMBER |
|------|---|--------------|
| C904 | CAPACITOR, ELECTROLYTIC, 1 μ F, 20%, 50V | 1-126-044-11 |

Applicable serial numbers: up to 19,600

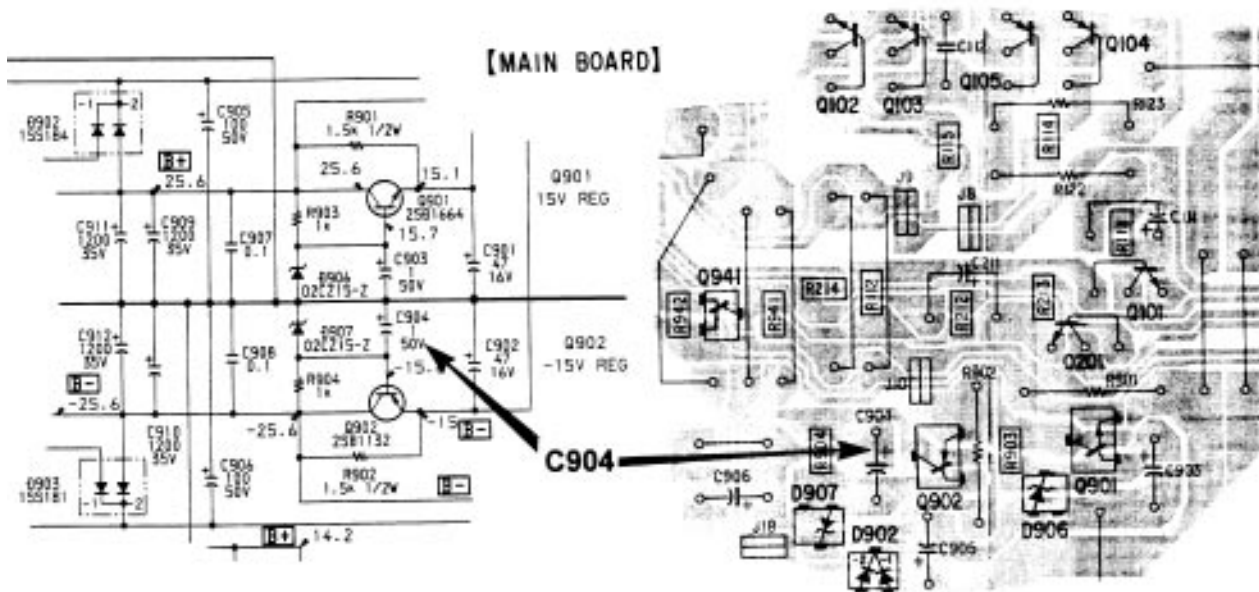

Filename: CAR0378.SB
Directory: J:\SBDOC\SEP95
Template: C:\WINWORD\TEMPLATE\S_BULL.DOT
Title:
Subject:
Author: Hoyt Wing Lee
Keywords:
Comments:
Creation Date: 09/13/95 11:23 AM
Revision Number: 2
Last Saved On: 09/13/95 11:23 AM
Last Saved By: Hoyt Wing Lee
Total Editing Time: 1 Minute
Last Printed On: 04/01/96 11:04 AM
As of Last Complete Printing
Number of Pages: 1
Number of Words: 159 (approx.)
Number of Characters: 911 (approx.)