

Car Stereo Service Bulletin

CSA-14

Sony Service Company - Technical Services
A Division of Sony Electronics Inc.
Sony Drive, Park Ridge, New Jersey 07656

Model: CDX-4090

No. 380

Subject: No Audio.

Date: November 10, 1995



Symptom:
(51)

The unit has no audio regardless of the source. In some instances the STEREO indicator on the display may always be illuminated. This problem may be caused by Q593 being defective.

Solution:

Check Q-593, and if found to be defective replace it. Also, change TH503 to a different type which offers greater protection against damage to Q593.

REF	FORMER		NEW	
	DESCRIPTION	PART NUMBER	DESCRIPTION	PART NUMBER
Q593	TRANSISTOR, 2SB1202FAST	8-729-822-84	SAME	SAME
TH503	THERMISTOR, 2.2 OHM	1-809-148-21	THERMISTOR, 2.0 OHM	1-809-842-21

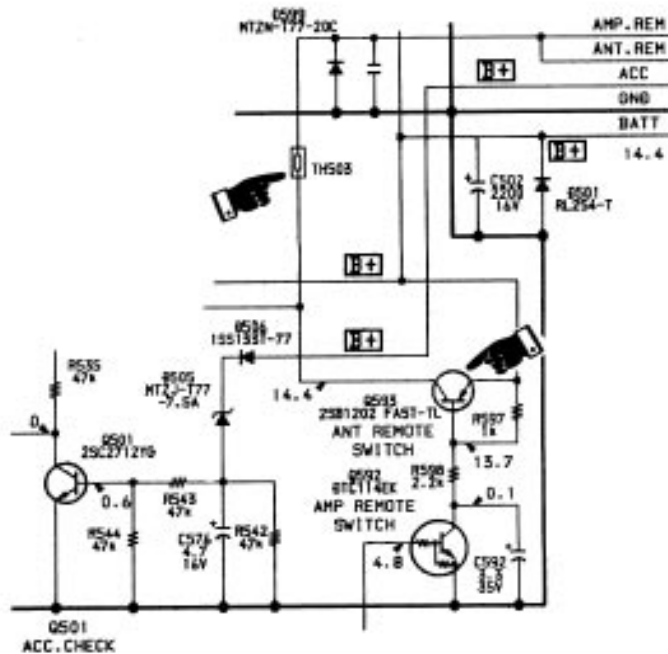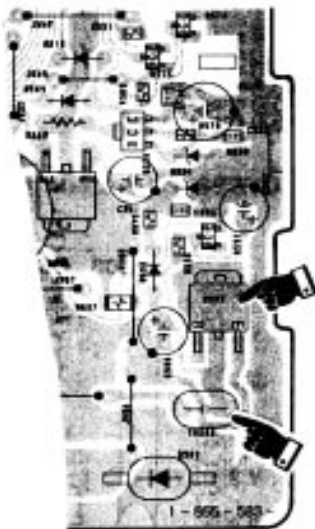

Filename: CAR0380.SB
Directory: J:\SBDOC\NOV95
Template: C:\WINWORD\TEMPLATE\S_BULL.DOT
Title:
Subject:
Author: Hoyt Wing Lee
Keywords:
Comments:
Creation Date: 11/10/95 10:07 AM
Revision Number: 2
Last Saved On: 11/10/95 10:07 AM
Last Saved By: Hoyt Wing Lee
Total Editing Time: 0 Minutes
Last Printed On: 04/01/96 10:18 AM
As of Last Complete Printing
Number of Pages: 1
Number of Words: 153 (approx.)
Number of Characters: 875 (approx.)