

# Car Stereo Service Bulletin

**CSA-14**

Sony Service Company - Technical Services  
A Division of Sony Electronics Inc.  
Sony Drive, Park Ridge, New Jersey 07656

**Model:** XR-C210, XR-C410

**No.** 383

**Subject:** Intermittent Audio Muting

**Date:** November 15, 1995

**Symptom:**  
(57)

The audio may intermittently mute at high volume levels.

**Solution:**



If the customer complains of this problem, change the value of C904 on the AMPLIFIER board as shown below.

REF	FORMER		NEW	
	DESCRIPTION	PART NUMBER	DESCRIPTION	PART NUMBER
C904	CAPACITOR, ELECT., 100UF, 10V	1-124-584-00	CAPACITOR, ELECT., 10UF, 16V	1-126-157-11

Serial number range in which this problem might be found:

XR-C210: 59501 - 67000      69501 - 77000  
108201 - 111144      120201 - 122200  
133801 - 137800

XR-C410 31401 - 42400      45401 - 48400  
59101 - 66576

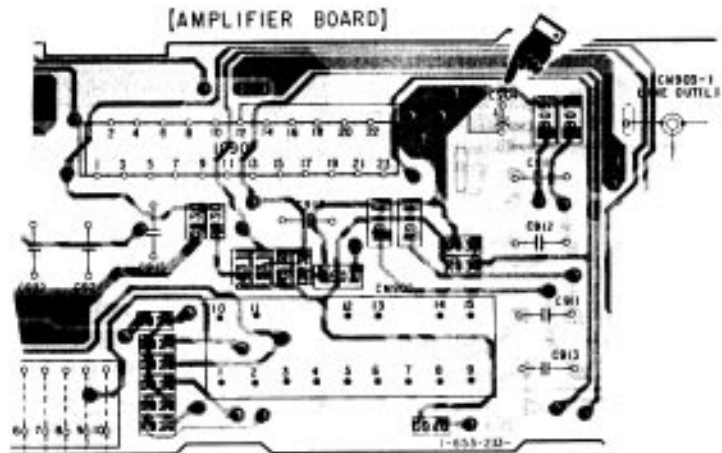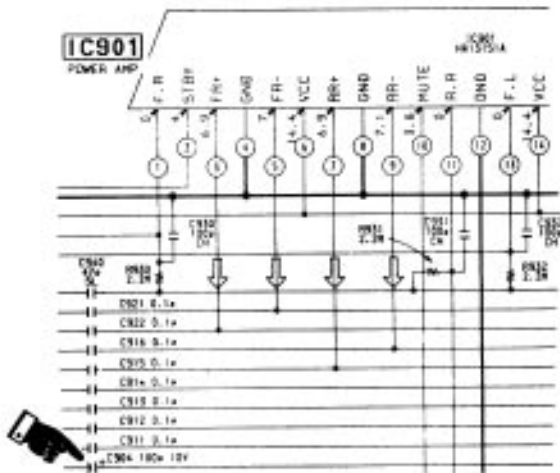

Filename: CAR0383.SB  
Directory: J:\SBDOC\NOV95  
Template: C:\WINWORD\TEMPLATE\S\_BULL.DOT  
Title:  
Subject:  
Author: Hoyt Wing Lee  
Keywords:  
Comments:  
Creation Date: 11/10/95 9:48 AM  
Revision Number: 3  
Last Saved On: 11/15/95 1:34 PM  
Last Saved By: Hoyt Wing Lee  
Total Editing Time: 2 Minutes  
Last Printed On: 04/01/96 10:19 AM  
As of Last Complete Printing  
Number of Pages: 1  
Number of Words: 156 (approx.)  
Number of Characters: 893 (approx.)