

# Car Stereo Service Bulletin

**CSA-14**

Sony Service Company - Technical Services  
A Division of Sony Electronics Inc.  
Sony Drive, Park Ridge, New Jersey 07656

**Model:** MDX-C150

**No.** 388

**Subject:** Does Not Read/Play MDs.

**Date:** December 14, 1995

**Symptom:**  
(51)

MDs are loaded but are intermittently not read or played.

**Solution:**

This problem may be caused by the adhesive from the lens cover preventing the optical pickup from achieving focus easily.

If the customer complains of this problem, use the following procedure to determine if the problem is caused by adhesive from the lens cover:

1- With the unit positioned upside down, load and play a disc. If the unit can load and play the disc successfully 10 times consecutively the problem is caused by something else. Troubleshoot the unit as usual.

2- If the unit fails the above test replace the optical pickup.

Applicable serial numbers: up to 32,000.

