

Car Stereo Service Bulletin

CSA-14

Sony Service Company - Technical Services
A Division of Sony Electronics Inc.
Sony Drive, Park Ridge, New Jersey 07656

Model: XR-6450

No. 389

Subject: Display Button Does Not Work.

Date: December 14, 1995

Symptom:

(13)

Pressing the DISPLAY button may have no effect when in FM mode and the field strength of the signal is greater than 60dB.

Solution:

If the customer complains of this problem add a 22K ohm resistor between JW25 and JW43 on the main board as shown below.

REF	DESCRIPTION	PART NUMBER
-	RESISTOR, CARBON 22K, 1/4W	1-247-863-91

Applicable serial numbers: 156,111 ~ 165,500
165,201 ~ 170,200
172,301 ~ 174,700
174,801 ~ 175,400

Preparing the resistor:

- 1- Cut the leads so that the overall length is 26mm.
- 2- Insulate the leads as shown.
- 3- Form the ends of the leads as shown.

