

# Car Stereo Service Bulletin

**CSA-14**

Sony Service Company - Technical Services  
A Division of Sony Electronics Inc.  
Sony Drive, Park Ridge, New Jersey 07656

**Model:** CDX-91

**No. 390**

**Subject:** No Audio With MDX-U1 Or XDP-U50D.

**Date:** March 25, 1996


**Symptom:**  
(51)

There is no audio when the CDX-91 is connected to the MDX-U1 or XDP-U50D via the analog connection (the audio is normal when the digital connection is used).

**Solution:**

This problem may occur if IC31 on the CDX-91 **SERVO** board is the newest type (CXP84332-014Q). If the above mentioned symptom occurs, and if IC31 is the newest type, replace it with the former type (CXP84332-008Q). **Also**, if the suffix of the silkscreened part number on the **MD** board is "-13" a trace on the **MD** board must be cut as shown in the illustration. **Finally**, if the XDP-U50D is being used, make sure that the procedure described in Car Stereo Service Bulletin # 377 has also been performed.

REF	NEWEST (NOT COMPATIBLE)		FORMER (COMPATIBLE)	
	DESCRIPTION	PART NUMBER	DESCRIPTION	PART NUMBER
IC31	IC, CXP84322-014Q	8-752-868-46	IC, CXP84332-008Q	8-752-861-08

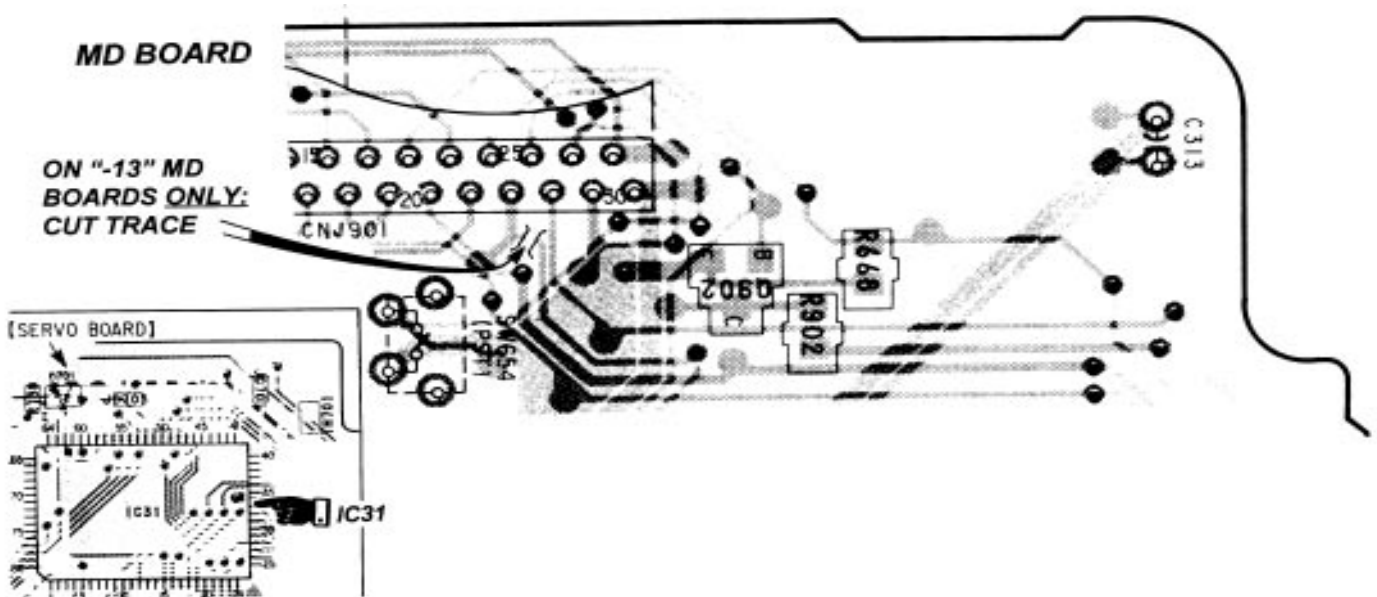

Filename: CAR0390.SB  
Directory: J:\SBDOC\MAR96  
Template: C:\WINWORD\TEMPLATE\S\_BULL.DOT  
Title:  
Subject:  
Author: Hoyt Wing Lee  
Keywords:  
Comments:  
Creation Date: 03/25/96 10:30 AM  
Revision Number: 2  
Last Saved On: 03/25/96 10:30 AM  
Last Saved By: Hoyt Wing Lee  
Total Editing Time: 1 Minute  
Last Printed On: 04/01/96 9:36 AM  
As of Last Complete Printing  
Number of Pages: 1  
Number of Words: 199 (approx.)  
Number of Characters: 1,138 (approx.)