

# Car Stereo Service Bulletin

**CSA-14**

Sony Service Company - Technical Services  
A Division of Sony Electronics Inc.  
Sony Drive, Park Ridge, New Jersey 07656

**Model:** MDX-100

**No.** 395

**Subject:** Skipping And/Or Drop-outs.

**Date:** April 4, 1996

**Symptom:**  
(57)

The unit may skip, or audio drop-outs may be heard. This problem may be caused by dust on the objective lens. The dust may be the result of the fan producing excessive air circulation.

**Solution:**

If skipping and/or drop-outs occur, and dust is found on the lens, change D501 on the Main board to a different type, and add a fan sheet as shown below.

REF	FORMER		NEW	
	DESCRIPTION	PART NUMBER	DESCRIPTION	PART NUMBER
D501	DIODE, MA8110-M	8-719-423-23	DIODE, MA8091-M	8-719-422-97
-	-	-	SHEET (FAN)	3-928-751-01

