

Car Stereo Service Bulletin

CSA-14

Sony Service Company - Technical Services
A Division of Sony Electronics Inc.
Sony Drive, Park Ridge, New Jersey 07656

Model: EXR-21, XR-6450, XR-C190, XR-C210, XR-C410 **No. 396**

Subject: No Tape Play In Reverse. **Date:** April 4, 1996

Symptom:
(62)

Shortly after reversing the tape, the mechanism returns to forward play. This problem may be caused by both pinch lever assemblies simultaneously engaging the tape and both capstans.

Solution: Replace the forward and reverse pinch lever assemblies as shown below:

REF	FORMER		NEW	
	DESCRIPTION	PART NUMBER	DESCRIPTION	PART NUMBER
111	PINCH LEVER (F) ASSY.	X-3368-266-1	PINCH LEVER (FS) ASSY.	X-3372-000-1
112	PINCH LEVER (R) ASSY.	X-3368-267-1	PINCH LEVER (RS) ASSY.	X-3372-001-1

