

Sony Service Company
National Technical Services
A Division of Sony Electronics Inc.
Park Ridge, New Jersey 07656

Service Bulletin Car Stereo

Model: CDX-91

No. 400

Subject: Pop Noise Prior To Start Of Audio.

Date: June 14, 1996

Symptom:

(54)

In some units after changing the disc, pop noise from the speakers may be heard prior to the start of audio.

Solution:

If the customer complains of this problem follow the procedure shown below.

REF	DESCRIPTION	PART NUMBER
C321	CAPACITOR ELECTROLYTIC (47uF/16V)	1-128-426-11

Applicable Serial Numbers: 10001 to 15000

Remove capacitor C321 from the MD board. Using the same type of capacitor solder the positive lead(+) of the capacitor to it's original positive (+) location. Bend the capacitor as shown in the diagram and mount it to the board using silicone compound. Next, take the ground(-) lead of the capacitor, attach a wire, and route it to the underside (solderside) of the board. Connect this lead wire to the minus side (-) of C912. Keep the wire length short as possible.

