

CONFIDENTIAL

CSA-14

Sony Service Company National Technical Services A Division of Sony Electronics Inc. Park Ridge, New Jersey 07656

Service Bulletin Car Stereo

Model: MDX-40 No. 407

Subject: MDX-40 KEEPS WORKING AFTER KEY IS Date: October 10, 1996

TURNED OFF. THIS CONDITION HAPPENS ONLY WHEN MDX-40 IS CONNECTED TO XR-

C900.

Symptom:

Reference: ME-96019

(311) MDX-40 will keep working after the key of the vehicle is turned off. This only happens

when the MDX-40 is connected to a XR-C900. After a while the car battery will

eventually drain.

Solution: Remove IC310 and replace it with a new improved one listed in the table below.

REF	DESCRIPTION	PART NUMBER
IC310	uPD78056GC-172-3B9	8-759-446-64