

**Model:** CDX-5070, CDX-5070FP, CDX-5270, CDX-5270FP, CDX-5470, CDX-5470FP, CDX-600DSP, CDX-600FP, CDX-900, CDX-900FP, CDX-900RFP, XR-340, XR-340FP, XR-430, XR-430FP, XR-U500, XR-U500FP, XR-U700, XR-U700FP, XR-U800, XR-U800FP, MDX-400, MDX-40

**No. 408**

**Subject:** REPAIR OF BROKEN PILOT LAMP **Date:** October 10, 1996

**Symptom:**  
(113) Pilot Lamp is open, this will make the backlighting inoperative.

**Solution:** Change all Pilot lamps to the improved listed in table below.

Replacement Number	Part Name	Part Number	Remark
1	Pilot Lamp	1-517-181-12	Green
2	Pilot Lamp	1-517-181-22	Amber
3	Pilot Lamp	1-517-181-32	Yellow

**Applicable models and serial numbers**

Model Name	Serial Number	Applicable Ref Number & Replacement Number
CDX-5070	~139300	PL801,PL802 , 1
CDX-5070FP	ALL	PL801,PL802 , 2
CDX-5270	~81500	PL850,PL851 , 1 PL801,PL802 , 2
CDX-5270FP	ALL	PL850,PL851 , 1 PL801,PL802 , 2



Car Stereo Products Service Bulletin No.408

CDX-5470	~42600	PL850,PL851 , 1 PL801,PL802 , 2
CDX-5470FP	ALL	PL850,PL851 , 1 PL801,PL802 , 2
CDX-600DSP	~13900	PL802,PL804 , 1 PL801,PL803 , 2
CDX-600FP	ALL	PL802,PL804 , 1 PL801,PL803 , 2
CDX-900	~11600	PL701,PL703,PL705 , 1 PL702,PL704,PL706 , 2
CDX-900FP	ALL	PL701,PL703,PL705 , 1 PL702,PL704,PL706 , 2
CDX-900RFP	ALL	PL701,PL703,PL705 , 1 PL702,PL704,PL706 , 2
XR-340	~27700	PL701,PL702 , 2
XR-340FP	ALL	PL701,PL702 , 2
XR-430	~19800	PL711,PL712 , 1
XR-430FP	ALL	PL711,PL712 , 1
XR-U500	~25300	PL703,PL704,PL706 , 2 PL701,PL702,PL705 , 1
XR-U500FP	ALL	PL703,PL704,PL706 , 2 PL701,PL702,PL705 , 1
XR-U700	~45600	PL703,PL704,PL706 , 2 PL701,PL702,PL705 , 1
XR-U700FP	ALL	PL703,PL704,PL706 , 2 PL701,PL702,PL705 , 1

Car Stereo Products Service Bulletin No.408

XR-U800	~23900	PL703,PL704,PL706 , 2 PL701,PL702,PL705 , 1
XR-U800FP	ALL	PL703,PL704,PL706 , 2 PL701,PL702,PL705 , 1
MDX-400	~15200	LAMP MOUNT , 3
MDX-40	~13300	LAMP MOUNT , 3