

Model: EXR-400, EXR-500, XK-R100, XK-6700, XR-C190, XR-C223, XR-C300, XR-C400, XR-C410, XR-C520, XR-C610, XR-C620, XR-C720

No. 410

Subject: THE TEETH OF THE LOADING GEAR MAY BECOME BROKEN. THIS MAY HAPPEN IN MG-50 SERIES MECHANICAL DECKS.

Date: October 22, 1996


Symptom:

(62) The Tape will not eject, and inserting a tape may become difficult.

Solution:

Replace the Loading Gear and Housing Hanger with new improved parts. The part numbers are listed in the table below. Fig 1 and Fig 2 illustrate the parts that need to be replaced.


REF	DESCRIPTION	PART NUMBER
	GEAR, LOADING	3-922-813-03
	HOUSING HANGER	3-912-882-01

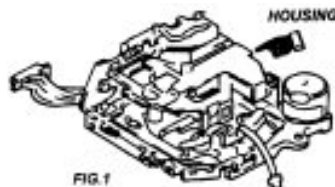

APPLICABLE

mechanism decks produced from Jan 1, 1995 to June 30, 1995 are applicable. The production date can be identified as shown in the illustration below

RANGE:

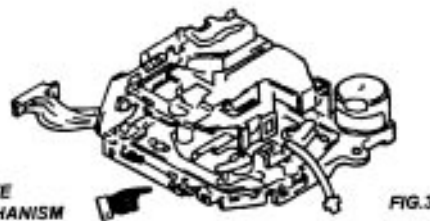

EXAMPLE: 45707_/_/_/_/C indicates mechanism was made on JULY 7, 1995. These numbers are printed on the mechanism. The applicable products will range from 450101_/_/_/_/C to 450630_/_/_/_/C

