

CONFIDENTIAL

CSA-14

Sony Service Company National Technical Services A Division of Sony Electronics Inc. Park Ridge, New Jersey 07656

Service Bulletin Car Stereo

Model: XR-C900 No. 414

Subject: NO POWER ON OR NO SOUND WHEN UNIT Date: January 6, 1997

HEATS UP

Symptom:

(11) The unit will have no power or no sound when a certain high temperature is reached.

This may be a protection circuit malfunction of the D/D converter (REF# DDC920).

Solution: Replace the DDC920 on the main board with an improved DC to DC converter

REF	DESCRIPTION	PART NUMBER
DDC920	DC TO DC CONVERTER	1-473-682-11

