

Sony Service Company National Technical Services A Division of Sony Electronics Inc. Park Ridge, New Jersey 07656

CONFIDENTIAL

Service Bulletin Car Stereo



Model: **CDX-C910**

418R1 No.

Subject: NO AUDIO OUTPUT

Date: May 6, 1997

Symptom:

- (151) The unit will not have audio on the line outputs, this may be caused by the PS1 fusible link open. The link is located on the main board conductor side and gives the B+ voltage to the DC to DC Converter.
- Solution: Replace the fusible link with a 0 ohm resistor. The part number for the 0 ohm resistor is 1-216-296-00.

Serial Numbers: up to 15700

REPLACE PSI WITH ZERO **OHM RESISTOR** [MAIN BOARD] (CONDUCTOR SIDE) o #0 * 0 *

c107