

CONFIDENTIAL

CSA-14

Sony Service Company National Technical Services A Division of Sony Electronics Inc. Park Ridge, New Jersey 07656

Service Bulletin Car Stereo

Model: CDX-C810DSP

No. 419

Subject: PICKUP IS HEARD THROUGH SUBWOOFER

Date: March 28, 1997

OUTPUTS.

Symptom:

(57)

Audible pickup can be heard through the subwoofer outputs. When the unit is tapped or shocked by vibration you can hear a thumping noise coming from the subwoofer outputs.

Solution:

Reference: FPR-R1615

There are two traces between C230 and C239. (see diagram below) If these traces have been cut, they need to be jumpered back for a connection. Jumper the two cut traces with thin wires on the solderside of the main board. After cut traces are reconnected, test unit by tapping chassis and monitoring subwoofer outputs.

