

Sony Service Company National Technical Services A Division of Sony Electronics Inc. Park Ridge, New Jersey 07656

CONFIDENTIAL



Service Bulletin Car Stereo

Model: CDX-81, CDX-91

No. 420

Date: March 28, 1997

Subject: AUDIO DROPOUTS

Symptom:

- (257) Audio Dropouts may be heard while certain CD's are being played. This may be caused by subcodes not being read correctly,which causes data to dropout. The audio passage may **sound** as if the CD is spinning faster.
- **Solution:** Replace IC31, the resistors, and capacitor, with the new parts shown in the table below.

REF	FORMER		NEW	
	DESCRIPTION	PART NUMBER	DESCRIPTION	PART NUMBER
IC31	CXP-84332- 020Q	8-752-871-74	CXP-84332- 044Q	8-752-883-12
R50,R51	15K OHM RESISTOR	1-216-835-11	18K OHM RESISTOR	1-216-836-11
C50	12 PICO FARAD CAPACITOR	1-163-229-11	6 PICO-FARAD CAPACITOR	1-163-223-11

Applicable Serial Numbers:

CDX-81	up to 48940
CDX-91	up to 33310

