## SONY®

## **CONFIDENTIAL**

CSA-14

Sony Service Company National Technical Services A Division of Sony Electronics Inc. Park Ridge, New Jersey 07656

## Service Bulletin Car Stereo

Model: CDX-C810DSP

No. 422

Subject: PICKUP IS HEARD THROUGH SUBWOOFER

**Date:** March 28, 1997

**OUTPUTS** 

Symptom:

(157) Audible pickup can be heard through the subwoofer outputs. When the unit is tapped

or shocked by vibration, you can hear a thumping noise coming from the subwoofer

outputs.

**Solution:** There are two traces between C230 and C239. (see diagram below) if these traces

have been cut they need to be jumped back for a connection. Jumper the two cut traces with thin wires on the solder side of the main board. After traces are reconnected, test unit by tapping chassis and monitor the subwoofer output.

[MAIN BOARD] (CONDUCTOR SIDE)

RI32

C 230

C 230

C 230

C 230

C 3 8 8