



Sony Service Company
 National Technical Services
 A Division of Sony Electronics Inc.
 Park Ridge, New Jersey 07656

CONFIDENTIAL

CSA-14

Service Bulletin Car Stereo

Model: CDX-2100, CDX-2160, CDX-3100, CDX-3160, CDX-4160, CDX-C410, CDX-C460, CDX-C510, CDX-C560, CDX-C610, CDX-C660, CDX-C710, CDX-C760, CDX-C810DSP, CDX-C860, EXCD-21, EXCD-31, EXCD-206

No. 424R1

Subject: INCOMPATIBILITY INFORMATION FOR CD CHASSIS

Date: June 12, 1997

Symptom:
 (XXX)

There may be an interchangeability problem between an older chassis mechanism and a new one. Use the Chart below to insure proper mechanism assembly. All Former Parts below should be changed so that mechanism will work properly.

Note: When changing old parts 1,2, and 3 you must also change 4 and 5. If former parts 4 and 5 need to be replaced, you do not have to replace 1,2,and 3.

Solution: Order the new corrected parts from the table listed below. (Chart ref # from CDX-3100 manual, reference numbers will vary with different models)

NO.	REF	FORMER		NEW	
		DESCRIPTION	PART NUMBER	DESCRIPTION	PART NUMBER
1	159	CHASSIS (M) COMPLETE ASSY	A-3291-568-A A-3291-677-A	CHASSIS(M) COMPLETE ASSY	A-3291-677-G
2	164	WHEEL, (U) WORM	3-934-879-01	WHEEL, (U) WORM	3-007-537-01
3	104	ROLLER ASSY	A-3291-567-A, A-3291-672-A	ROLLER ASSY	A-3301-203-A
4	111	CHASSIS (T) ASSY	A-3291-816-A	CHASSIS(T) ASSY	A-3291-816-B
5	103	ARM(ROLLER)	3-931-902-02, 3-931-902-01	ARM(ROLLER)	3-931-902-03

Applicable Serial Number Range: Look at the number stamp on the Mech. Deck. A number whose **last** 2 digits are greater than 38 should have new parts already. If it is below 38 it is using former parts.

Example: 6x241**37**- former part, 6x241**38**- new part

(Continued)

