

Model: CDX-3100, CDX-3160, CDX-4160, CDX-5100,
CDX-C410, CDX-C510, CDX-C610, CDX-C710,
CDX-C810DSP, EXCD-21, EXCD-31, EXCD-206,
EXCD-306, EXCD-406, EXR-C205, XR-C350, XR-
C400, XR-C450, XR-C500, XR-C700, XR-1750,
XR-3753

No. 427

Subject: DISTORTED OR NO AUDIO IN ONE OR BOTH
CHANNELS

Date: May 6, 1997

Symptom:
(251)

Some of units may have problems with the audio output. This may be due to insufficient solder connections from the power amplifier IC (HA13155) to the MCB. If you are experiencing these symptoms you should inspect the power amplifier inside the unit. There may be poor solder connections. Ring cracks may be visible around several pins.

Solution: Resolder and carefully inspect Power Amp IC. Make sure solder connections are good.

**CHECK IC200
SOLDER
CONNECTIONS
CDX-3100 MAIN
BOARD SHOWN**

