

SONY

Car Stereo
Service Bulletin

Sony Service Company - Technical Services
A Division of Sony Corporation of America
Sony Drive, Park Ridge, New Jersey 07656

Model: CDX-5040

No. 206

Subject: No Operation

Date: July 26, 1991


Symptom: (11) The unit does not turn on when the ignition key is turned to "ON" or "ACCESSORY".

Solution: Replace the following parts on the connector board:

REF.	FORMER		NEW	
	Description	Part No.	Description	Part No.
R902	RESISTOR, METAL CHIP 1K Ω 5% 1/8 W	1-216-198-00	RESISTOR, CHIP 2.2K Ω 1/10 W	1-216-057-00
C917	CAPACITOR, CERAMIC CHIP 0.47 μ f 16V	1-162-637-11	CAPACITOR, ELECT. 0.47 μ f 50V	1-126-159-11

Applicable serial numbers: up to 148,200.

CSA-14 CD Player

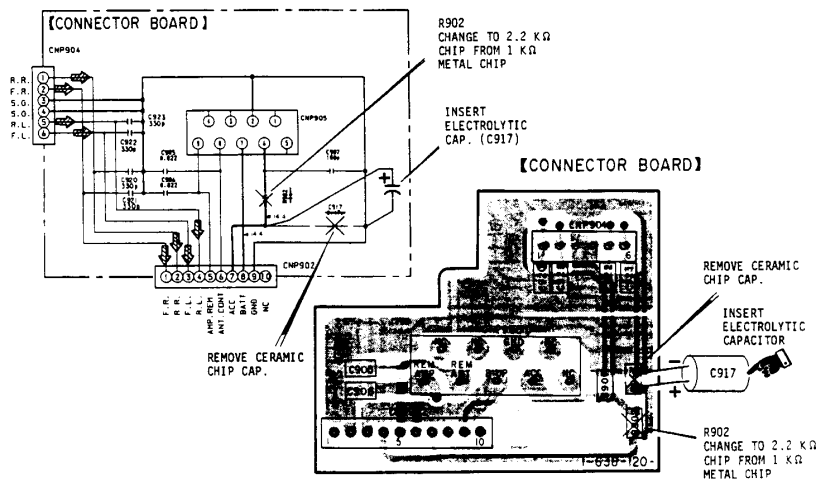

Reference: Tech News ME-91005

PRINTED IN U.S.A.
CSA-14791-1