

SONY

Car Stereo
Service Bulletin

Sony Service Company Technical Services
A Division of Sony Corporation of America
Sony Drive, Park Ridge, New Jersey 07656

Model: CDX-5080

No. 225

Subject: Unit Enters Auxiliary Mode Inadvertently

Date: January 20, 1992

Symptom:
(22)

The AUX (Walkman) input may become inadvertently activated when the MUTE button is pressed or when the front panel is touched in the vicinity of the Walkman button. The previous mode of operation (CD or Tuner) is cancelled and AUX appears on the display.


Solution:

Replace the 5.0mm rubber cushion on side A of the display board with a new cushion that is 4.8mm thick. The cushion is located near the Walkman switch on the display board.

DESCRIPTION		PART NUMBER	
FORMER	NEW	FORMER	NEW
CUSHION (D) 5.0MM	CUSHION (D) 4.8MM	-----	3-376-006-01

Compact Disc
CSA-14

DISPLAY BOARD (Side A)

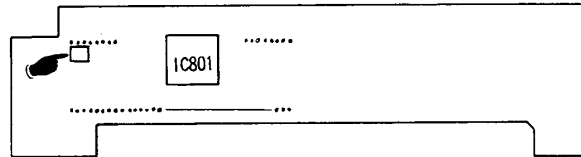

Applicable serial numbers: Up to 203200