

SONY

Car Stereo
Service Bulletin

Sony Service Company - Technical Services
A Division of Sony Corporation of America
Sony Drive, Park Ridge, New Jersey 07656

Model: XR-U880

No. 227

Subject: No Power When Front Panel Is Installed

Date: January 27, 1992


Symptom: (11) The unit will not turn on when the front panel is installed.

Solution: Perform the following modifications on the Key MCB:

1. Replace IC702
2. Replace CNP-701 (Improved; same part number as original)
3. Remove D702

REF.	DESCRIPTION		PART NUMBER	
	FORMER	NEW	FORMER	NEW
IC702	μPD75008GB-632-3B4	μPD75008GB-647-3B4	8-759-154-94	8-759-045-36
CNP-701	CONNECTOR, PLUG 10P	CONNECTOR, PLUG, 10P	1-580-806-11	1-580-806-11
D-702	DIODE, DTZ6.2B	—	8-719-977-07	—

Applicable serial numbers: up to 109700

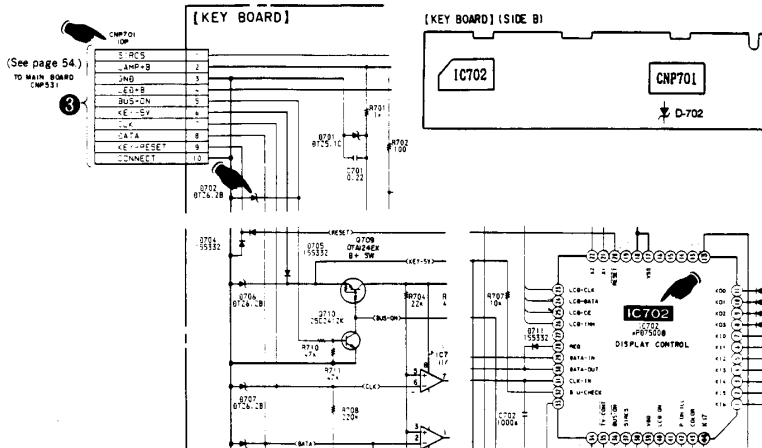

Reference: Tech News #ME-91014

PRINTED IN U.S.A.
CSA-13192-6

CSA-14 Tuner/Tape Deck