

SONY

**Car Stereo
Service Bulletin**

Sony Service Company Technical Services
A Division of Sony Corporation of America
Sony Drive, Park Ridge, New Jersey 07656

Model: XR-U880

No. 228

Subject: Low Contrast On LCD Display

Date: January 27, 1992


Symptom:
(13) The LCD display has low contrast.

Solution: Perform the following modifications on the Main MCB and the Key MCB:

1. Change D-717 on the Key MCB from DTZ5.1C to DTZ6.2B.
2. Change D-524 on the Main MCB from DTZ11B to RD12ESB2.

REF	FORMER		NEW	
	DESCRIPTION	PART NUMBER	DESCRIPTION	PART NUMBER
D-717	DTZ5.1C	8-719-977-00	DTZ6.2B	8-719-977-07
D-524	DTZ11B	8-719-977-32	RD12ESB2	8-719-110-31

Applicable Serial Numbers: Up to 109700

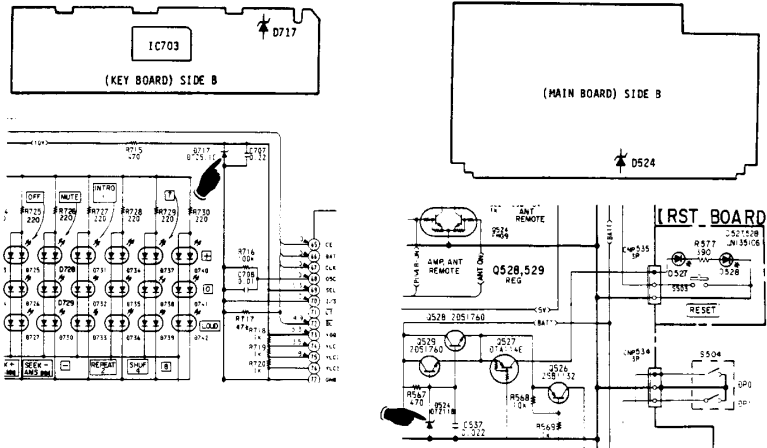

Reference: Tech News #ME-91016

PRINTED IN U.S.A.
CSA-14192-7

CSA-14 Tuner / Tape Deck