

**SONY.**

**Car Stereo  
Service Bulletin**

Sony Service Company - Technical Services  
A Division of Sony Corporation of America  
Sony Drive, Park Ridge, New Jersey 07656

**Model:** CDX-A15RF/A30RF; XA-7A

**No. 231**


**Subject:** No Audio From Tuner And/Or CD Changer

**Date:** March 20, 1992

**Symptom:**  
(51) There is no audio from the tuner and/or CD changer.

- Solution:**
1. Repair the unit by replacing Q-1 and/or IC-1 on the modulator board as required.
  2. Prevent re-occurrence of the problem by adding the following parts to the modulator board:

DESCRIPTION	PART NUMBER
ZENER DIODE, 1ZB27	8-719-027-42
RESISTOR, 22Ω 1/4W	1-246-433-15

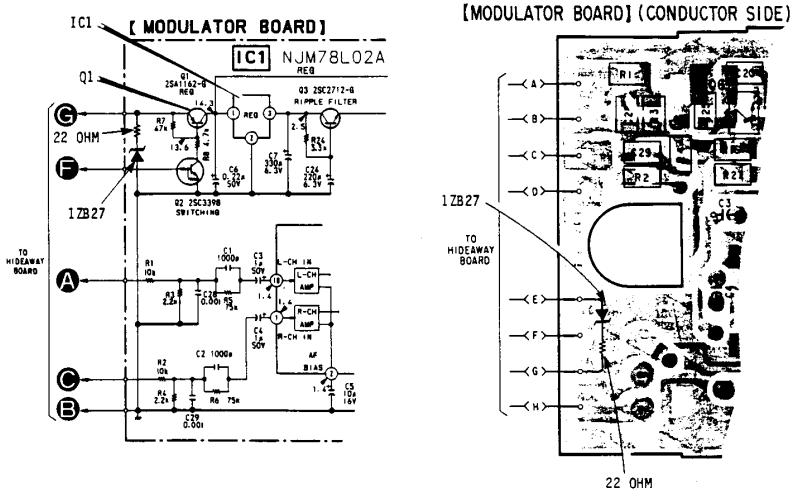

Reference: FPR NO202

PRINTED IN U.S.A.  
CSA-14392-1

CSA-14 CD Player