

SONY.

Car Stereo Service Bulletin

Sony Service Company - Technical Services
A Division of Sony Corporation of America
Sony Drive, Park Ridge, New Jersey 07656

Model: XR-7070

No. 234

Subject: Silkscreen Error, IC701 On Key MCB



Date: May 29, 1992

Symptom:
(**)

The beveled corner of the silkscreened outline for IC701 is located at the true pin #1 location, but the beveled corner of the IC itself does not indicate pin #1. If a new IC701 is installed with its beveled corner lined up with the beveled corner of the silkscreened outline, the display will not work.

Solution:

Note the mounting orientation of the original IC and install the replacement IC the same way. If you forget the original orientation, make sure the IC is installed as shown below:

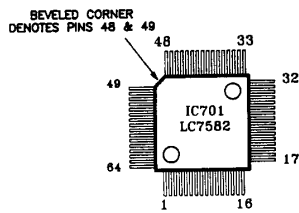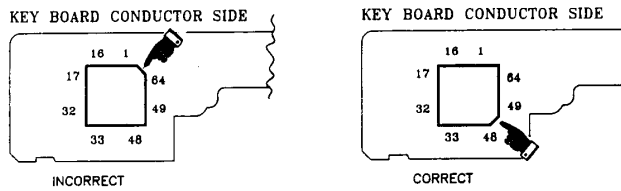

Reference: FPR N0762

PRINTED IN U.S.A.
CSA-14592-2

CSA-14 Tuner / Tape Deck