

SONY

Car Stereo
Service Bulletin

Sony Service Company - Technical Services
A Division of Sony Corporation of America
Sony Drive, Park Ridge, New Jersey 07656

Model: CDX-4040/5180/U8000, EXCD-40

No. 236

Subject: Low Audio Output Level When Using Walkman Input

Date: June 10, 1992


Symptom:
(52)

When playing a source which is delivered through the Walkman input, the audio output level is low.

Solution: Change the Walkman input resistors according to the table below:

MODEL	REF	FORMER		NEW	
		DESCRIPTION	PART NUMBER	DESCRIPTION	PART NUMBER
CDX-4040	R-128	RESISTOR, 100Ω	1-216-025-00	RESISTOR, 1kΩ	1-216-049-00
	R-228	1/10W		1kΩ	1/10W
CDX-5180	R-140	RESISTOR, 100Ω	1-216-025-00	RESISTOR, 1kΩ	1-216-049-00
	R-240	1/10W		1kΩ	1/10W
CDX-U8000	R-130	RESISTOR, 100Ω	1-216-025-00	RESISTOR, 1kΩ	1-216-049-00
	R-230	1/10W		1kΩ	1/10W
EXCD-40	R-128	RESISTOR, 100Ω	1-216-025-00	RESISTOR, 1kΩ	1-216-049-00
	R-228	1/10W		1kΩ	1/10W

CDX-4040, EXCD-40

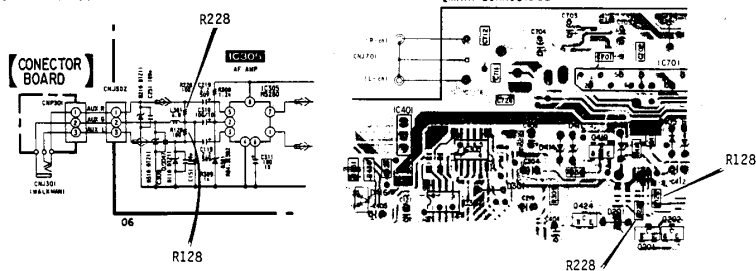

(Continued)

Reference: FPR N0896

PRINTED IN U.S.A.
CSA-14592-5

CSA-14 CD Player

