

SONY.

Car Stereo Service Bulletin

Sony Service Company - Technical Services
A Division of Sony Corporation of America
Sony Drive, Park Ridge, New Jersey 07656

Model: CDX-7560/7580/5040/7540/7520/5180/
5080/4040/6020/ U8000/R77/R79/ EXCD-40
Subject: MD Board Screws Come Loose


No. 241

Date: June 30, 1992

Symptom:
(11) MD Board screws come loose, shorting out parts on the Main Board. The usual customer complaint is "DEAD".

Solution: Perform the following modification:
Change the MD Board screws from 3mm to 5mm.

DESCRIPTION		PART NUMBER
FORMER	NEW	
SCREW, 2 X 3	SCREW, 2 X 5	7-621-771-06

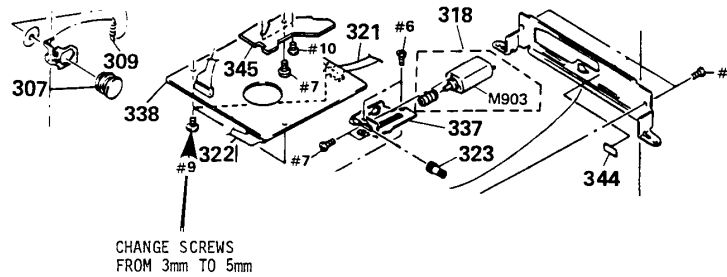

CSA-14 CD Player