

SONY

Car Stereo Service Bulletin

Sony Service Company Technical Services
A Division of Sony Corporation of America
Sony Drive, Park Ridge, New Jersey 07656

Model: CDX-5040/5080/5180/7520/
7540/7560/7580/U8000

No. 249R1

Subject: Chattering Noise And/Or Skipping At
The Beginning Of The Disc

Date: January 12, 1993


This bulletin supersedes Car Stereo Service Bulletin No.249

Symptom:
(64)

When playing the first track of a disc, a chattering noise may be heard from the CD mechanism. In other instances, skipping may occur when playing the first track on the disc.

Solution: Adjust the limit switch SW-91 on the sensor board as follows:

1. Remove the solder which secures both contacts of the switch to the sensor board, then loosen the screw which is mounted through the plastic body of the switch.
2. Position the switch body so that the contacts are aligned as shown in the drawing.
3. Tighten the screw which was loosened in Step 1. **Do Not Over-tighten!**
4. Resolder the switch contacts to the sensor board and verify that the switch alignment is still correct.

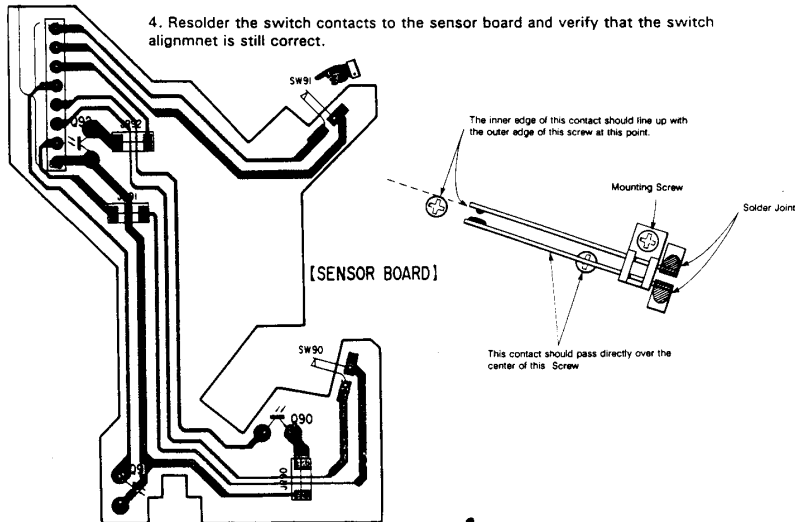

Reference: FPR N1583



PRINTED IN U.S.A.
CSA-14193-1

CSA-14 Tape Deck