

**SONY**

# Car Stereo Service Bulletin

Sony Service Company - Technical Services  
A Division of Sony Corporation of America  
Sony Drive, Park Ridge, New Jersey 07656

**Model:** EXR-25; XR-4257/4357

**No.** 252

**Subject:** Tuner Pre-sets Are Lost Or "SDK" Appears  
On The Display

**Date:** August 14, 1992

**Symptom:**  
(22)

Tuner pre-sets are lost when power antenna is activated, or when unit is removed from the mounting sleeve. In some instances, "SDK" appears on the display.

- Solution:**
1. Add a 10K $\Omega$  resistor in parallel with C-411 on the main board (XR-4257 only).
  2. Add an 11ES2 diode to the power antenna circuit (REM out) on the Main MCB.

DESCRIPTION	PART NUMBER
RESISTOR, 10K $\Omega$ , 1/6W CARBON	1-249-429-11
DIODE, 11ES2	8-719-200-82


Applicable Serial Numbers (for addition of diode):

EXR-25	100,001 - 106,000
XR-4257	100,001 - 145,800
XR-4357	10,001 - 121,000

Applicable Serial Numbers (for addition of resistor):

XR-4257	All
---------	-----

## EXR-25

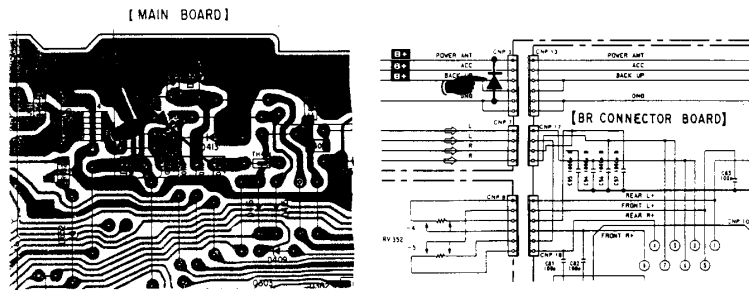

(Continued)

Reference: Tech News ME-92003 / ME-92006  
Autoflagging-Yes

PRINTED IN U.S.A.  
CSA-14792-2

CSA-14 Tuner/Tape Deck

