

SONY

Car Stereo Service Bulletin

Sony Service Company - Technical Services
A Division of Sony Corporation of America
Sony Drive, Park Ridge, New Jersey 07656

Model: XR-U330

No. 253

Subject: External Amplifiers Turn On Five (5) Seconds
After The XR-U330 Has Been Turned Off

Date: August 31, 1992

Symptom:
(22)



External amplifiers controlled by the XR-U330 will turn on five (5) seconds after the XR-U330 has been turned off.

Solution:

Move R-254 to the unused R-255 position on the Main MCB. Press the reset button after the unit has been powered up.

CAUTION: This solution results in the elimination of the warning beep that is heard through the speakers when the customer forgets to remove the faceplate. Be sure to obtain the customer's approval before moving R-254.

[MAIN BOARD](CONDUCTOR SIDE)

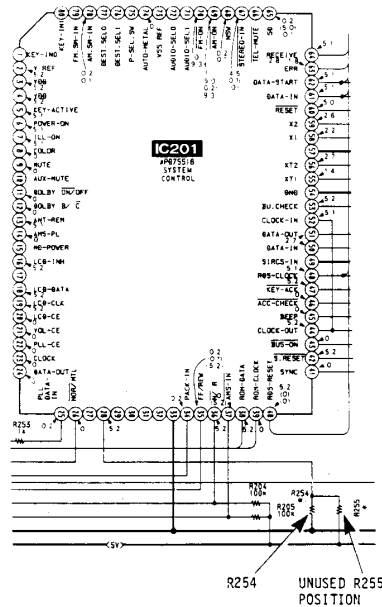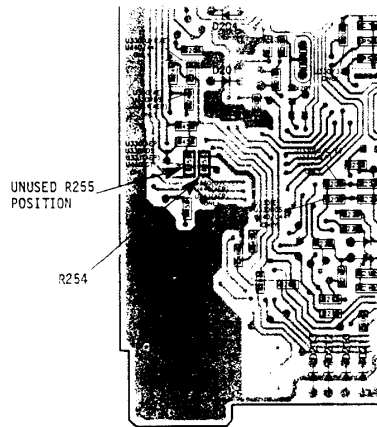

CSA-14 Tuner/Tape Deck