

SONY

Car Stereo Service Bulletin

Sony Service Company - Technical Services
A Division of Sony Corporation of America
Sony Drive, Park Ridge, New Jersey 07656

Model: XR-U220/U330

No. 257

Subject: May Not Turn On When Ignition Key Is Turned On

Date: September 17, 1992

Symptom:
(11)

The XR-U220 and the XR-U330 may not turn on when the ignition key is turned on if they are connected to Unilink CD Changers (CDX-U200/U400/U400D/U500).

Solution:

Pressing the reset button, or unplugging and replugging the Unilink Cable will temporarily restore normal operation. In order to prevent reoccurrence of the problem, change IC-201 on the Main Board to an improved type.

REF.	FORMER		NEW	
	DESCRIPTION	PART NUMBER	DESCRIPTION	PART NUMBER
IC201	IC, μ PD75518GF-047-3B9	8-759-082-40	IC, μ PD75518GF-058-3B9	8-759-086-50

Applicable Serial Numbers: XR-U200 - UP TO 137075
XR-U330 - UP TO 168900

