

**SONY**

**Car Stereo  
Service Bulletin**

Sony Service Company - Technical Services  
A Division of Sony Corporation of America  
Sony Drive, Park Ridge, New Jersey 07656

**Model:** CDX-U8000

**No. 260**

**Subject:** Does Not Retain Last Volume Setting

**Date:** September 23, 1992


**Symptom:**  
(52)

When the unit is turned on, it may not operate at the same volume level it was operating at when it was turned off. Pressing the VOLUME + or VOLUME - button once will restore the volume level.


**Solution:**

Add the following components to the Walkman Input Amplifier Circuit:

DESCRIPTION	PART NUMBER
DIODE, ZENER RD7.5ESB2	8-719-110-03
RESISTOR, METAL CHIP 6.8K	1-216-069-00

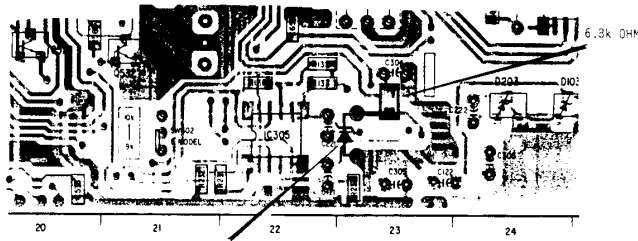

MAIN BOARD  
(CONDUCTOR SIDE)

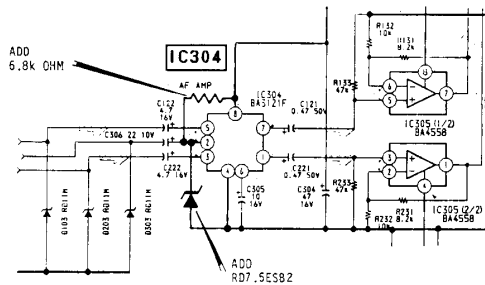

Reference: AOKI - ME 1.2 Fax

PRINTED IN U.S.A  
CSA-14992-3

CSA-14 CD Player