

SONY

**Car Stereo
Service Bulletin**

Sony Service Company · Technical Services
A Division of Sony Corporation of America
Sony Drive, Park Ridge, New Jersey 07656

Model: XR-U220

No.262

Subject: Tuner Audio Level May Be Lower Than Audio Level From The Tape and CD

Date: September 23, 1992


Symptom:
(52)

The audio level when listening to the tuner may be lower than the audio level when listening to a tape or CD.

Solution:

Measure the value of resistors R-70 and R-90 in the tuner section of the Main Board. If the values of these resistors are different than the values specified below, replace them with the correct resistors:

REFERENCE NUMBER	DESCRIPTION	PART NUMBER
R-70, R-80	RESISTOR, 0 OHM	1-216-295-00

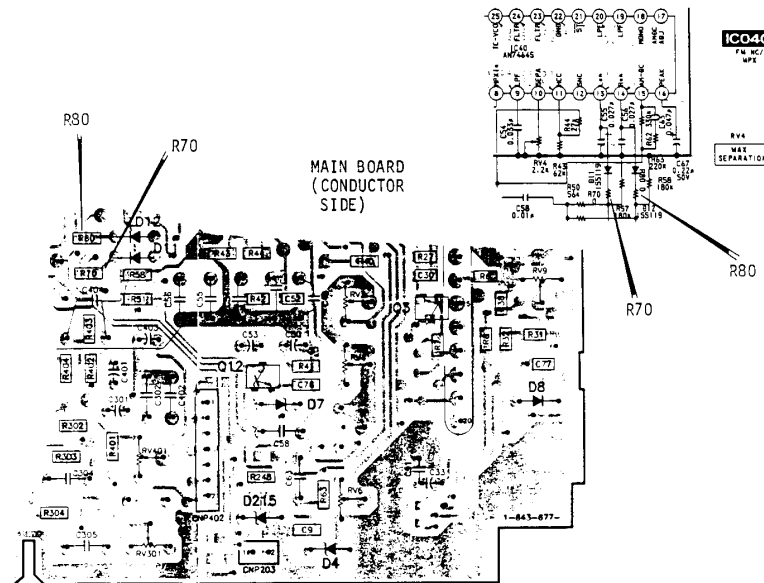

CSA-14 Tuner/Tape Deck