

SONY

Car Stereo
Service Bulletin

Sony Service Company Technical Services
A Division of Sony Corporation of America
Sony Drive, Park Ridge, New Jersey 07656

Model: XES-P1/X1

No. 274

Subject: System Does Not Turn On If Long (18')
Unilink Cable Is Used.

Date: February 10, 1993

Symptom:


(11)

The system may not turn on if a long (18') Unilink cable is used between the XES-X1 crossover and the display unit or the hideaway unit (or both).


Solution:

Add RB100A diodes in parallel with D-604 on the XES-P1 DISPLAY board and D-401 on the XES-X1 DIGITAL board.



REF	DESCRIPTION	PART NUMBER
-	DIODE, RB100A	8-719-981-50

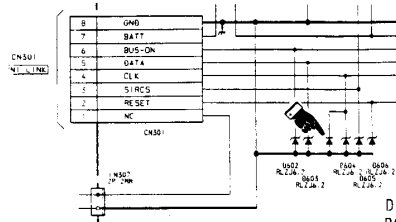

DISPLAY BOARD XES-P1

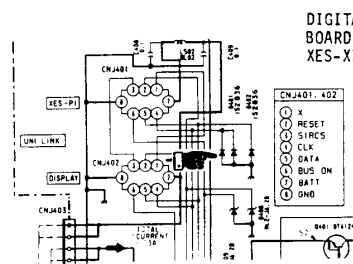

DIGITAL BOARD XES-X1

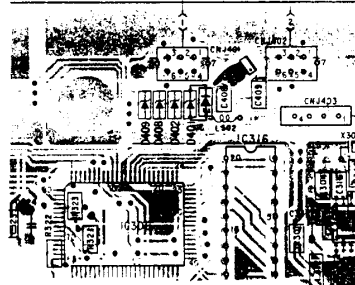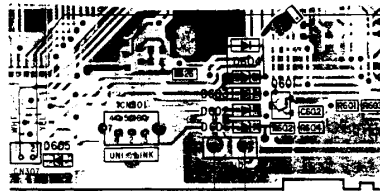

CSA-14 Pre - Amp / Signal Processor