

SONY.

Car Stereo Service Bulletin

CSA-14

Sony Service Company - Technical Services
A Division of Sony Corporation of America
Sony Drive, Park Ridge, New Jersey 07656

Model: XR-6500/7130/7150/7180/7200/7280/
7307/7500/7600 **No.283**


Subject: Direction Changes Or Tape Ejects During Play **Date:** May 21, 1993

Symptom:
(62)

The direction of play may change before the end of the tape has been reached.
Also, the tape may be ejected even though the eject button is not pressed.

Solution: Replace the supply and take-up reel table assemblies with the improved parts shown below.

REF	FORMER		NEW	
	DESCRIPTION	PART NUMBER	DESCRIPTION	PART NUMBER
154	TABLE ASSEMBLY, REEL	X-3344-104-1 OR X-3362-213-1	TABLE ASSEMBLY, REEL	X-3362-213-5

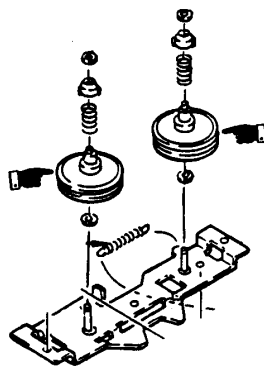

Reference: Technical News ME-93003
Autoflagged - NO



PRINTED IN USA
CSA-14593-2