

**SONY**

# Car Stereo Service Bulletin

**CSA-14**

Sony Service Company - Technical Services  
A Division of Sony Corporation of America  
Sony Drive, Park Ridge, New Jersey 07656

**Model:** XES-M1

**No.284**

**Subject:** R 135, R 235 Overheat



**Date:** May 21, 1993

**Symptom:**

(\*\*) R 135 and R 235 show signs of overheating. Operation of the unit appears to be unaffected.

**Solution:** Replace R 135 and R 235 with parts having a higher power rating.

REF	FORMER		NEW	
	DESCRIPTION	PART NUMBER	DESCRIPTION	PART NUMBER
R 135, R 235	RESISTOR, 10 OHM, 1/2 W	1-247-727-11	RESISTOR, 10 OHM, 2 W	1-212-372-11

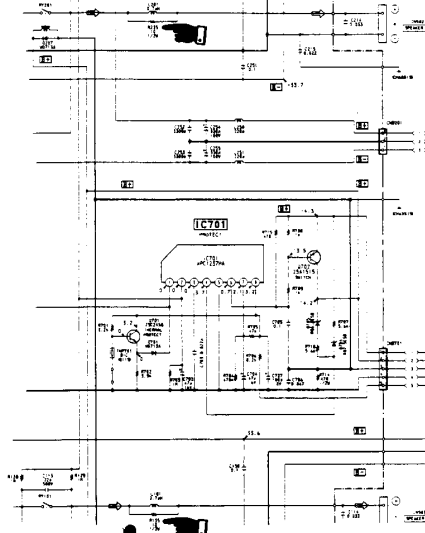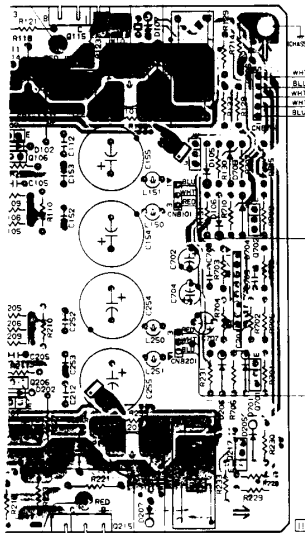

Reference: Tokyo FAX TX-USA93051  
Autoflagged - YES



PRINTED IN USA  
CSA-14593-3