

SONY.

**Car Stereo
Service Bulletin**

CSA-14

Sony Service Company - Technical Services
A Division of Sony Corporation of America
Sony Drive, Park Ridge, New Jersey 07656

Model: XR-U550/U660

No.285

Subject: Antenna Remote Line Does Not Function


Date: May 21, 1993

Symptom:

(22) The Antenna Remote line does not function because Q 522 is damaged.

Solution: Replace Q 522, and prevent it from becoming damaged again by adding an 11ES2 diode between the ANTENNA REMOTE line and ground on the AMP board.

REF	DESCRIPTION	PART NUMBER
Q 522	TRANSISTOR, 2SB1184-F5R	8-729-922-47
-	DIODE, 11ES2	8-719-200-82

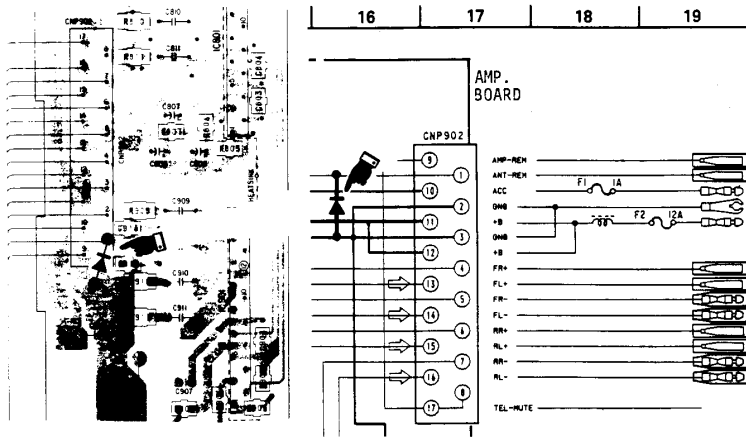

Reference: Technical News ME-93004
Autoflagged - YES



PRINTED IN USA
CSA-1459 3-4