

SONY.

Car Stereo Service Bulletin

CSA-14

Sony Service Company - Technical Services
A Division of Sony Corporation of America
Sony Drive, Park Ridge, New Jersey 07656

Model: XR-U220/U330

No.288

Subject: Antenna Remote Line Does Not Function


Date: May 21, 1993

Symptom:

(22) The Antenna Remote line does not function because Q 106 is damaged.

Solution: Replace Q 106, and prevent it from becoming damaged again by adding an 11ES2 diode between its collector and ground.

REF	DESCRIPTION	PART NUMBER
Q 106	TRANSISTOR, 2SB1202FAST	8-729-822-84
	DIODE, 11ES2	8-719-200-82

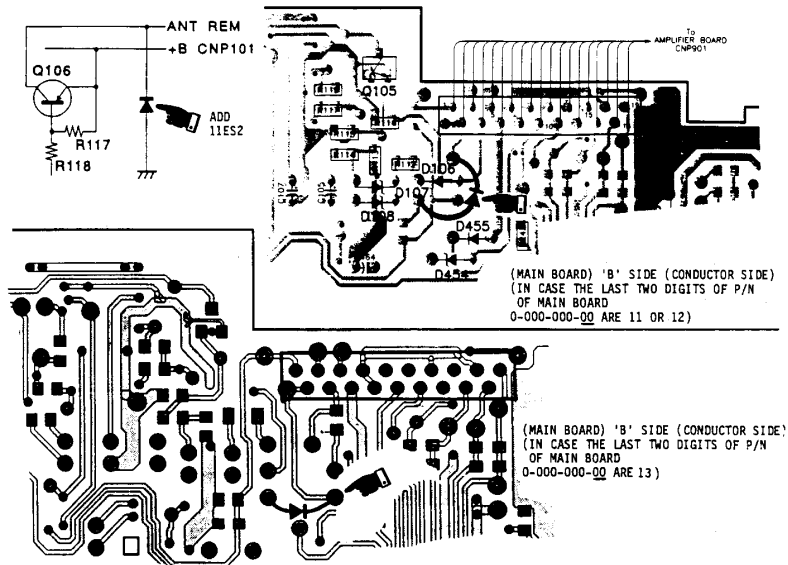

Reference: Technical News ME-93004
Autoflagged - YES



PRINTED IN USA
CSA-14593-1