

SONY.

Car Stereo
Service Bulletin

CSA-14

Sony Service Company - Technical Services
A Division of Sony Corporation of America
Sony Drive, Park Ridge, New Jersey 07656

Model: XR-U220/U330

No. 289

Subject: CD Changer Mode Cannot Be Selected

Date: May 28, 1993

Symptom:

(22)

The CD changer mode cannot be selected because the solder of the Unilink connector or R238 is cracked.

Solution:

Replace R238 (if necessary) and/or resolder the Unilink connector. Prevent the damage from re-occurring by adding a spacer to the Unilink connector as shown below.

REF	DESCRIPTION	PART NUMBER
R238	RESISTOR, METAL GLAZE, 100 OHM	1-216-174-00
-	SPACER	3-389-290-01

1- Remove the heat sink.

2- Apply the spacer to the upper side of the Unilink connector, between the connector and the sheet metal.

Applicable serial numbers: XR-U220 120341 and higher

XR-U330 142601 to 248601

(Continued)

Reference: Technical News ME-93001
Autoflagged - YES



PRINTED IN USA
CSA-14593-7

