

SONY.

Car Stereo Service Bulletin

CSA-14

Sony Service Company - Technical Services
A Division of Sony Electronics
Sony Drive, Park Ridge, New Jersey 07656

Model: CDX-U70/U300/U300RF/U303/U303RF **No. 291**

Subject: CD Changer Generates Reset At Random,
Causing Controller To Shut Off, and CD Changer
Begins Reading Table Of Contents For Each Disc. **Date:** August 12, 1993


Symptom:
(11) The CD changer generates a reset at random. This causes the CD controller to shut off, even if a mode of operation other than CD mode is being used at the time. The CD changer then reads the table of contents of each disc in the magazine.

Solution: Add a 0.1µF capacitor between pin 1 of IC653 and ground on the Main board or MD board (depending on which board is found in the unit), as shown in the diagrams below.

Applicable Serial Numbers:

CDX-U70 up to 49,400
CDX-U300 all
CDX-U300RF 156,001 - 158,000
CDX-U303 up to 31,100
CDX-U303RF up to 22,500

REF	DESCRIPTION	PART NUMBER
-	CAPACITOR, METAL FILM (0.1µF, 50V)	1-136-742-11

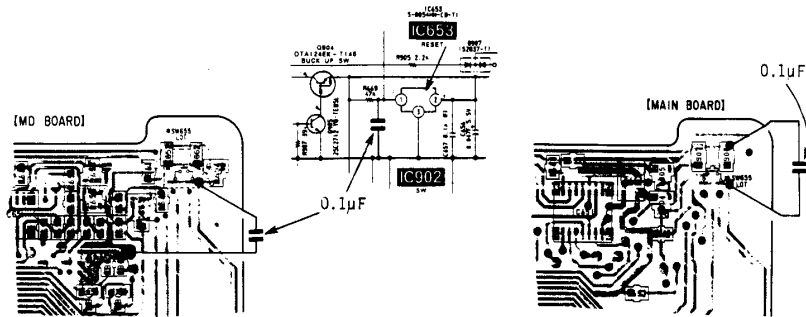

Reference: Technical News ME-93022
Autoflagged - Yes



PRINTED IN USA
CSA-14793-2