

**SONY.**

# Car Stereo Service Bulletin

**CSA-14**

Sony Service Company - Technical Services  
A Division of Sony Electronics Inc.  
Sony Drive, Park Ridge, New Jersey 07656

**Model:** MDX-U1

**No.** 295

**Subject:** Does Not Eject Discs

**Date:** August 31, 1993



**Symptom:**

(61) The unit may not eject the disc.


**Solution:** Replace SW621 on the loading board, and the rack, with the improved parts as shown below.

REF	FORMER		NEW	
	DESCRIPTION	PART NUMBER	DESCRIPTION	PART NUMBER
SW621	SWITCH, PUSH (1 KEY)	1-572-467-31	SWITCH, PUSH (1 KEY)	1-572-467-61
209	RACK	3-384-442-01	RACK	3-384-442-11

Applicable serial numbers: up to 18,000

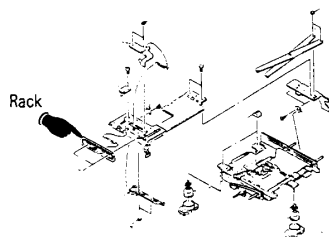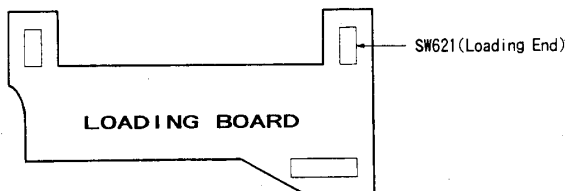


**Original Rack**

 

Total number of the teeth is the original number less 3 teeth

Apply grease to first 3 teeth

**Improved Rack**

 

Reference: Technical News ME-93016  
Autoflagged - YES



PRINTED IN USA  
CSA-14893-4