

SONY

Car Stereo
Service Bulletin

CSA-14

Sony Service Company - Technical Services
A Division of Sony Electronics Inc.
Sony Drive, Park Ridge, New Jersey 07656

Model: CDX-U70/U300/U303

No. 298

Subject: Head Unit May Not Turn On If CD Changer Is Connected.

Date: October 19, 1993

Symptom:
(11)


If one of the above mentioned CD changers is connected to a Unilink head unit, the head unit may not turn on.

Solution:


If this symptom is observed, inspect the Jack flexible board for signs of chafing which may be caused by the flexible board rubbing against the metal chassis. If damage to the flexible board is found, replace it and prevent the problem from re-occurring by adding an insulating sheet to the metal chassis.

REF	DESCRIPTION	PART NUMBER
-	INSULATING SHEET	3-327-119-01

Applicable serial numbers: CDX-U70 up to 48801
CDX-U300/U300RF ALL
CDX-U303 up to 23,901

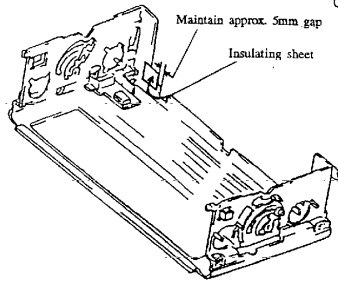

If the insulating sheet is unavailable, the repair can be made by applying any insulating tape to the chassis as shown below

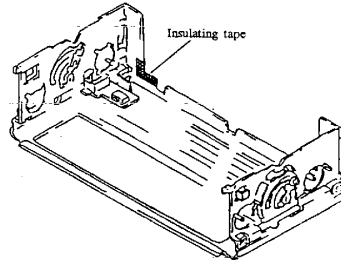

Reference: Technical News ME-93017
Autoflagged - YES



PRINTED IN USA
CSA-141093-2