

**SONY**

# Car Stereo Service Bulletin

**CSA-14**

Sony Service Company - Technical Services  
A Division of Sony Electronics Inc.  
Sony Drive, Park Ridge, New Jersey 07656

**Model:** XR-U550

**No. 305**

**Subject:** CAUTION ALARM is not easily audible.

**Date:** October 29, 1993



**Symptom:**

(52) The customer may complain that the CAUTION ALARM is not easily audible.

**Solution:**

If the customer complains of this, make the following circuit changes to increase the volume.

- 1- Cut the pattern between R542 and the emitter of Q527.
- 2- Add a jumper wire between R542 and the BATT line as shown below.

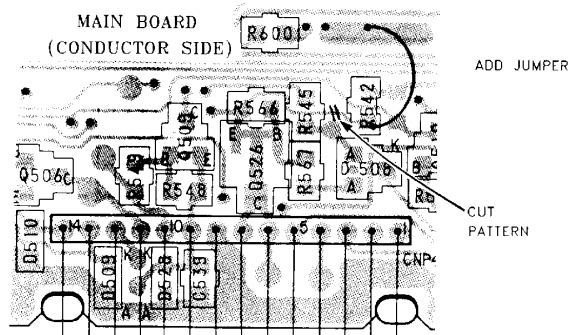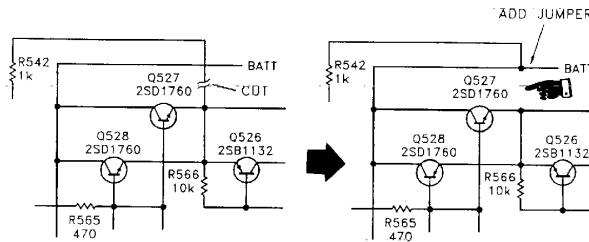

Reference: Canada Bulletin CS-240  
Autoflagged - NO



PRINTED IN USA  
CSA-141093-5