

SONY.

**Car Stereo
Service Bulletin**

CSA-14

Sony Service Company - Technical Services
A Division of Sony Electronics Inc.
Sony Drive, Park Ridge, New Jersey 07656

Model: CDX-U606; XES-P1/X1

No. 314

Subject: No Audio After AMS Or Disc Change

Date: March 18, 1994

Symptom:
(51)


If the CDX-U606 is used in a system which also includes the XES-P1 and XES-X1 the audio may cut out after AMS'ing or after changing discs.

Solution:

If this symptom occurs in the above mentioned system configuration, replace CPU IC31 on the **CDX-U606 Servo board** with an improved version.

REF	DESCRIPTION	PART NUMBER
IC31	IC, CXP82224-013Q	8-752-853-08

[SERVO BOARD]

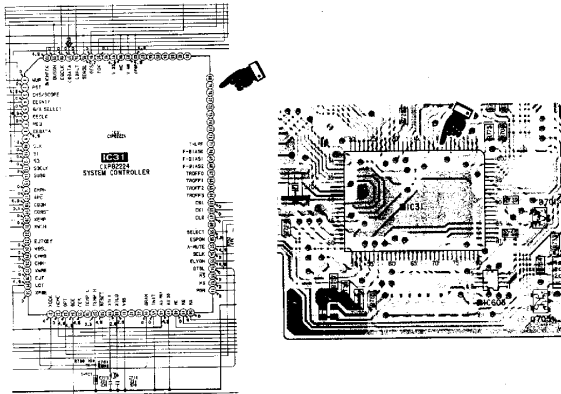

Reference: Technical News ME-93038
Autoflagged - NO



PRINTED IN USA
CSA-14394-2

