

SONY.

Car Stereo
Service Bulletin

CSA-14

Sony Service Company - Technical Services
A Division of Sony Electronics Inc.
Sony Drive, Park Ridge, New Jersey 07656

Model: XR-U220/U330/U550/U660 **No.** 322

Subject: Loses Memory Presets; Clock Resets To 1:00 **Date:** May 13, 1994

Symptom:
(13) The memory presets are lost, and the clock resets to 1:00.

Solution: Replace reset IC101 on the Main board for the XR-U220 and XR-U330, or IC504 on the Main board for the XR-U550 and XR-U660.*

REF	DESCRIPTION	PART NUMBER
IC101 (XR-U220/U330)	IC, S-8054HN-CB-S	8-759-940-45
IC-504 (XR-U550/U660)	IC, S-8054HN-CB-S	8-759-940-45

* The same symptoms will be observed if the customer has the memory back-up wire (usually the yellow wire) connected to a switched 12V source rather than a constant 12V source. In this case, the customer may claim that the presets and time are lost after the unit has been switched off for a while, or after the faceplate has been removed from the unit for a while.


Also, the presets and time will be lost whenever the customer presses the reset button, which the customer may occasionally do in response to the RESET indication on the display.

Be sure to alert the customer to these possibilities.


(Continued)




[MAIN BOARD]

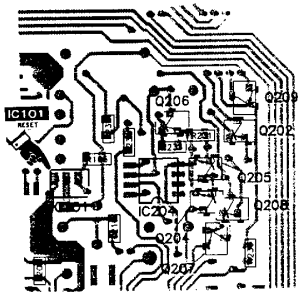

XR-U220/U330

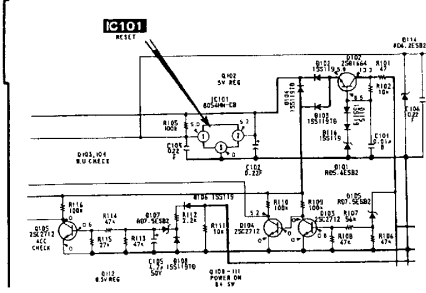

[MAIN BOARD] (CONDUCTOR SIDE)

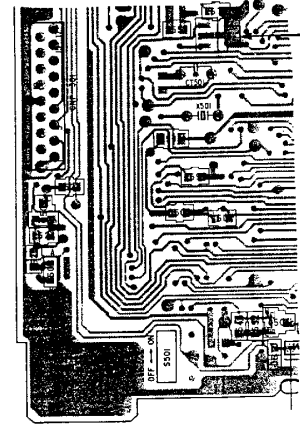

XR-U550/U660

