

**SONY.**

Car Stereo  
**Service Bulletin**

**CSA-14**

Sony Service Company - Technical Services  
A Division of Sony Electronics Inc.  
Sony Drive, Park Ridge, New Jersey 07656

**Model:** CDX-5060

**No.** 323

**Subject:** No Functions Due To Main Board/ Display Board  
Incompatibility.

**Date:** May 27, 1994


**Symptom:**  
(12)

After replacing the Main Board or the Display Board, the unit may not respond to any function buttons.

**Solution:**

This problem may be caused if a **Main Board** having a silk-screened suffix of -12 is connected with a **Display Board** having a silk-screened suffix of -11. In this case, normal operation can be restored by adding a jumper resistor to the -11 Display Board as shown below.

REF	DESCRIPTION	PART NUMBER
JR801	JUMPER RESISTOR, 0 OHM	1-216-295-00

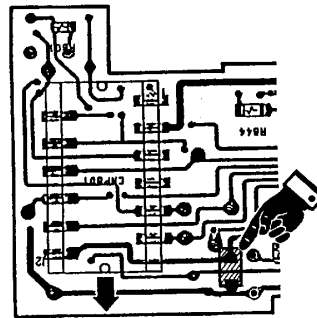

DISPLAY BOARD (Side B)